6059 Plus Print Error Guide
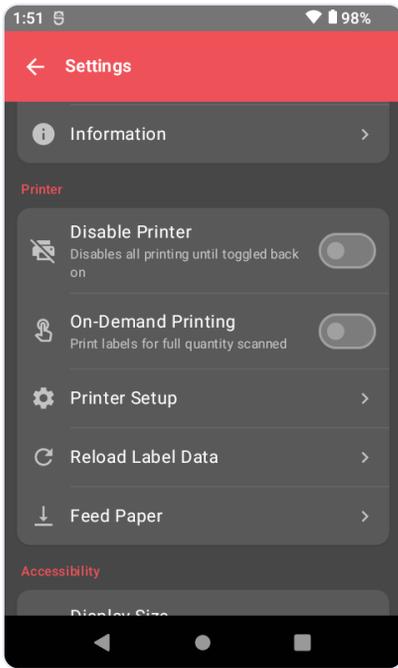
SCANIT PARTS®

Step 1. Tap Settings
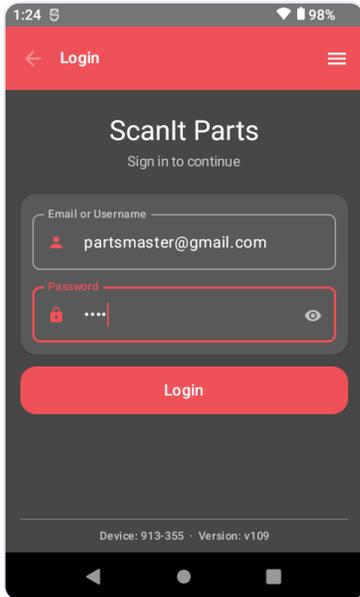
Step 2. Tap Printer Setting
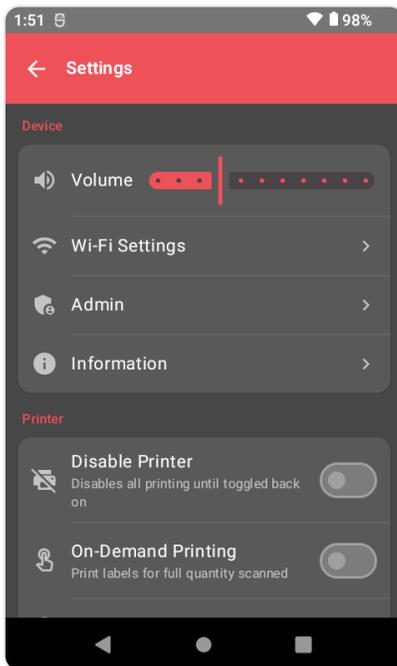
Step 3. Tap Printer Setup

Step 4. Tap Supply

Printer Setup Menu

Printer Setup screen showing menu options: **Supply** (Supply/Sensor types and calibration) highlighted **?**, Energy (Energy settings and test labels), Scanner (Scanner setup and tests), Device Hardening (Lock down features), Printer Info (Voltage and temp details), Print Head Info.

Step 5. Tap Calibrate Black Mark Sensor

Only tap once. This may print blank labels.

Supply Settings

Supply screen showing: Sensor Type: Black Mark, **Calibrate Blackmark Sensor** button **?**, Calibrate On-Demand Sensor button, Feed button, Supply Position (-99 - 99) set to 0.

Step 6. Swipe Left to Go Back to the Main Menu